WURLITZER

Organ Notes

Your questions or comments on
"Organ Notes" are welcome at any time.

Issued by Wurlitzer Service Dept., DeKalb, Illinois

FREQUENCY RESPONSE - MODEL 500 TONE CABINET

UNDER CERTAIN ACOUSTICAL CONDITIONS, A LACK OF PROPER RESPONSE MAY BE NOTED ON MODEL 500 TONE CABINETS BELOW SERIAL # 393501. THE FREQUENCY RESPONSE CAN BE ALTERED BY CHANGING THREE COMPONENTS IN THE AMPLIFIER AS SHOWN ON THE SCHEMATIC DIAGRAMS BELOW.

PARTS REQUIRED

1 EACH- 120Ω, ½ WATT RESISTOR
1 EACH- 680Ω, ½ WATT RESISTOR
1 EACH- .56 MFD., 100 VOLT CAPACITOR

BEFORE CHANGE

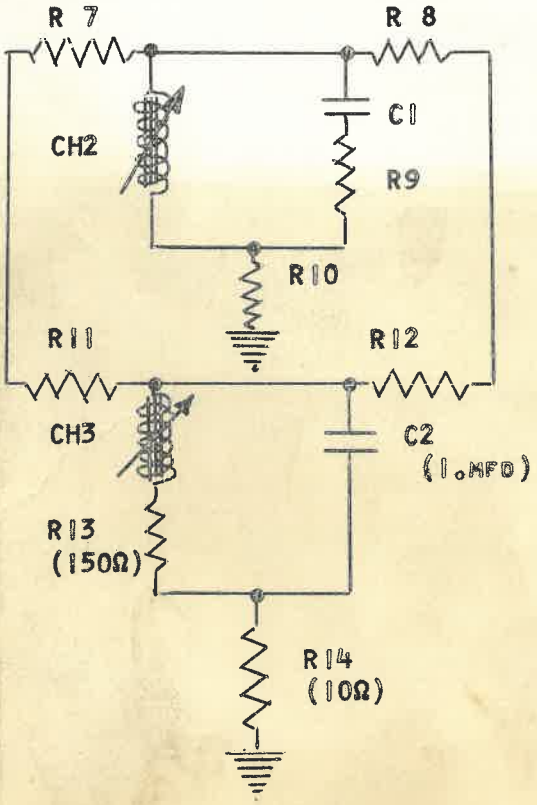

AFTER CHANGE

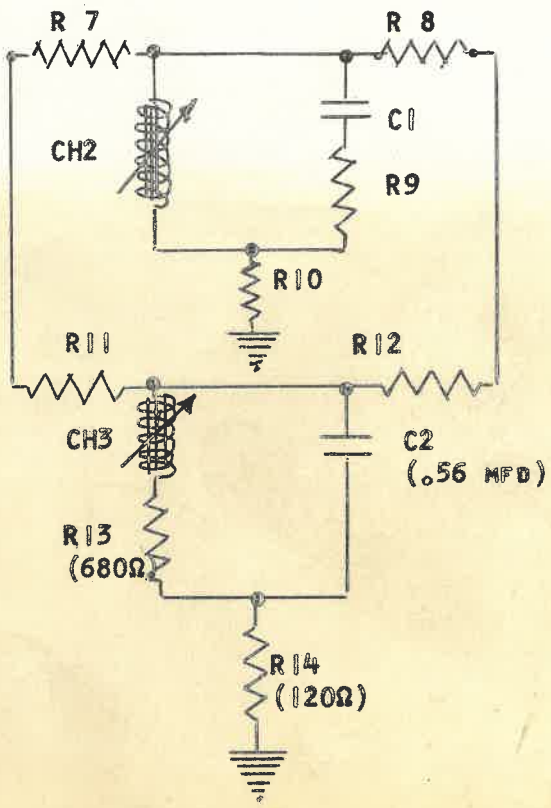

(FOR COMPLETE SCHEMATIC, SEE SCHEMATIC PART # 117850)